

Telephone:08532-235999
Karnataka State Fire And Emergency Services Department



Office of the District fire officer
Karnataka state fire and Emergency Services
Raichur Fire station, Raichur 584102,



Date: 15/02/2025

C.NO:14/FSR/DFO/RCR/2025

"Fire Safety Recommendation"
ANNEXURE-I

Group-B Educational Building

"B1 And B2- Schools Up to Senior Secondary Level and other institutions"
NBC-2016, Part-4, Table 7 (1) 3. 1. 3 Group-B Educational Buildings

To,

The Authorized Signatory,
The Principal
Icon Future International School
R.H No-03 Main Road, Muchal camp Sindhanur,
Taluk:Sindhanur Dist:Raichur-584143.

Sir/Madam.


Sub:-Issue of "Fire Safety Recommendation" to **Babugouda Badarli Education Charitable Trust**
@ a Low rise School Building **Icon Future International School** at R.H No-03
Main Road, Muchal camp Sindhanur, Taluk:Sindhanur Dist:Raichur-584143.

Ref: 1.C.No:04/FSO/SFS/2025, Date:13/02/2025.
2. Applicant Request Letter on Dated:12/02/2025.

With reference to the subject above cited, the premises of to **Babugouda Badarli Education Charitable Trust** @ a Low rise School Building **Icon Future International School** at R.H No-03 Main Road: Muchal camp Sindhanur, Taluk:Sindhanur Dist:Raichur-584143. was inspected by Fire station Officer Sindhanur on Date:12/02/2025 with respect to fire prevention, fire fighting and evacuation measures to be complied premises and Submitted building details as under.

A. Details of the Building/Premises:-

01.	Name and Address of the applicant.	: The Principal Icon Future International School R.H No-03 Main Road, Muchal camp Sindhanur, Taluk:Sindhanur Dist:Raichur-584143.
02.	Name and Address of the premises.	: Icon Future International School at R.H No-03 Main Road, Muchal camp Sindhanur, Taluk:Sindhanur Dist:Raichur-584143.
03.	Name and Address of the Building owner.	: The President Sri Anjaneya Yakamanda Pwd camp Sindhanur, Sindhanur Taluk Raichur, District-584128
04.	Number of Buildings	: 01 No.
05.	Number of floors	: Ground floor+1 Upper floor.
06.	Floor-wise details of occupancy :-	

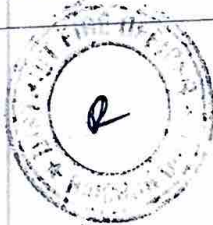

Head Master
Icon Future International School
R.H. No.3 Main Road, Muchal Camp,
SINDHANUR-584143 Raichur
Icon Future International School

	Ground Floor:	:	1. Class Room-08 No. 2. Office Room-01 No.	
	First Floor:	:	1. Computer Lab -01 No. 2. Science Lab-01 No. 3. Class Room-05 No. 4. Boys Wash Room-01 No. 5. Ladies Wash Room-01 No.	
07	Height of the building	:	07.10 Mtrs.	
08	Site area	:	5574.18 Sq.Mtr.	
09	Built-up area of each floor :-			
	Ground Floor	:	493.98 Sq Mtrs	
	First Floor	:	419.56 Sq Mtrs	
	Built-up area	:	913.54 Sq Mtrs	
11	Surrounding properties:-			
	East (Front)	:	Under Construction Hostel Building	
	West (Rear)	:	Residential Houses	
	North (Side)	:	Agriculture Land	
	South (Side)	:	Agriculture Land	
12.	Set back area available around the Building:-			
	East (Front)	:	10.90 Mtrs.	Recommended: To provide as per Local Zonal Regulations.
	West (Rear)	:	08.80 Mtrs.	
	North (Side)	:	42.40 Mtrs.	
	South(Side)	:	04.20 Mtrs.	

B. On inspection of this Institutional premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl.No [01]	Details [02]	Existing [03]	Recommendations [04]
01	Accessibility to Premises.	The premises is accessible from 6.00 Mtrs Wide Internal Service Road On Eastern side and the road is hardened to carry the weight of 45,000 kgs.	--
02	No of entrances.	01 No.	--
03	No. of staircases Available	No of staircase : 01 No	--
		Width of staircase : 01.40, Mtrs.	
		Width of treads : 29 CM	
		Height of risers : 13 CM	
		No of riser per flight : 14 No	
		Height of handrails : 0.70 Mtrs.	

e

4

	Head room clearance		
<p>Portable Fire Extinguisher</p>		<p>Provided 08 No's of DCP Extinguisher for 06 Kg Capacity Each Floor.</p>	<p>Recommended To Provide</p> <ol style="list-style-type: none"> 01 No ABC Fire Extinguisher each of 6 kg capacity Should be Located as Available Within 15 Mtrs Radius. in each floor. 01 No of CO2 Fire Extinguisher of 4.5 kg capacity Should be Provided near each Electrical Panel Board And Electrical Room. Switch board. 01 Mechanical Foam Extinguishers of 09 ltrs Capacity and 01 ABC type Extinguishers of 6 kg capacity should be provided near diesel Generator. (All the extinguishers suggested above should be with B.I.S. markings and should be located at an easily accessible position without obstructing the normal passage and maintained periodically).
<p>05 First aid Hose reel hose.</p>		<p>Not Provided</p>	<p>Recommended To Provide</p> <p>01 No of Hose reel hose Near the Staircase (one hose Reel hose System for every 1000 Sq Mtrs) The hose Reel of 30 mtr length with drum and 01 no's delivery hose pipes minimum 2 1/2 inch size of adequate length to reach the farthest point of each floor has to be provide with a shut off branch having a nozzle of 2 mm size. The hose reel hose has been connected at each.</p>
<p>06 Terrace tank over respective tower terrace.</p>		<p>Not Provided</p>	<p>Recommended to Provide</p> <p>The System Should Be connected An Over Tank of 10,000 Ltr water Capacity And Further Basement is Provided the Tank Capacity Should be Increased To 5,000 Lts Capacity. (The Water Tank Should Be Kept Exclusively Fire Fighting Purpose). Note If the Existing Building is Not Capable Of sustaining the weight 5000/10000 Ltrs Tank Capacity Provision Shall be made to Provide Water Tank On the Side Of the Building With Support From Ground Level by providing RCC Column Structure are MS Column Structure. If The There No Option to Provide even the Above Mentioned Over Tank Provision Shall Made To provide Underground Water Tank Of capacity With Submersible Pump of 05 To 07 Hp Capacity.</p>
<p>07 At the terrace tank level with minimum pressure of 3.5 kg/cm².</p>		<p>Not Provided.</p>	<p>Recommended to Provide</p> <p>01 No pump with minimum pressure of 3.5 kg/sq. cm.</p>
<p>08 Diesel Generators</p>		<p>Not Provided.</p>	<p>Recommended To Provide 15KV of Diesel Generator to alternate power supply.</p>
<p>09 Escape routes</p>		<p>Not Provided.</p>	<p>Recommended To Provide Direction in which the students have to move in the event of an emergency should be displayed in the corridor in each floor during evacuation.</p>



Handwritten signature in blue ink.

10	Fire order (Fire Safety Plans)	Not Provided.	The Notice board have been indicted the action should be taken by the employees in case of any emergency should be displayed with the telephone number of Sindhanur Fire Station i.e-08535-220777 and the telephone number of nearest Ambulance services and Police Station.
11	No Smoking Board	Displayed	Provided COTPA Sec-4 direction No Smoking area smoking here is an offence board should be written in English & Kannada both language have been prominently displayed in building at inside the entry / exit of the each floor.
13	Fire Siren	Not Provided.	A Fire Siren shall installed in the premises to inform the inmates in case of a fire emergency and evacuate the area.
14	Nominate Fire Fighting Training	Not Imparted	At-least 40% of School Staff should be got trained in basic fire fighting at R.A.Mundkur fire & Emergency Services Academy, Bannerughatta road, Bangalore within 3 months or at an early date.

Fire Precautionary Measures:-

- A. Explosive and Flammable Materials Should Not be Stored in the Store Room, UPS Room Electrical Panel Area. Class Rooms. Laboratory And Electrical Some Panel Premises.
- B. Accumulation of combustible Waste in and around the premises should be avoided.
- C. The Exit Ways Shall be always Kept Clear Without any obstruction.
- D. Liquefied Petroleum Gas Should Not be Stored in the building.
- E. The doors shall not kept Locked/ Latched during working-hours and shall be free from obstruction.
- F. During the class hours in the class room doors shall not be locked from inside to outside.
- G. As per Honorable Supreme Court Order All Teachers and staffs Shall be trained to handle Safety Equipment, initiate Emergency Evacuation and Protect Their Students in the event of Fire and other Emergency and the school shall observe the Fire Safety Day on April 14th of Every Year by Conducting Fire Safety Drills with Co-ordinate with fire service Department.

Under the Circumstance stated above, there is No Objection to run Education activities in your Constructed School Building **Babugouda Badarli Education Charitable Trust** @ a Low rise School Building **Icon Future International School** at R.H No-03 Main Road, Muchal camp Sindhanur. Taluk:Sindhanur Dist:Raichur-584143subject to the Condition of providing Additional Fire Fighting Equipments and Fire precautionary measures shown in Part-B. Therefore management should compulsory Karnataka Fire And Emergency Services Department Conditions to provide Additional Equipments And Then-Intimate to the office Within 90 days Positively Without Fail. **This Fire Safety Recommendation Certificate Valid for Only One Year From The date of issue and renewable without fail.**

All Requirements Recommended above are as per National Building Code-2016 Part-4 Clause3.1.3 of Fire And Life Safety Will have to be complied With Mandatorily.

Copy To:

- 1.The DGP KSF&ES
Banglore-560042.
- 2.Fire Station Officer
Fire Station Sindhanur.

Yours faithfully

[Handwritten Signature]
 15/10/2020
 584143

Karnataka State Fire And Emergency Services Department



Office of the District fire officer
Karnataka state fire and Emergency Services
Raichur Fire station, Raichur 584102,



C.NO:59/FSR/DFO/RCR/2025

Date:08/08/2025

"Fire Safety Recommendation"

ANNEXURE-I

Group-B Educational Building

"B1 And B2- Schools Up to Senior Secondary Level and other institutions"
NBC-2016, Part-4, Table 7 (11) 3. 1. 3 Group-B Educational Buildings

To,

The Authorized Signatory,
The Principal
Icon Future International School,
R.H.No.3, Main Road, Muchal Camp,
Taluk.Sindhanur, Dist:Raichur-584143.

Sub:- Issue of "Fire Safety Recommendation" to Sri Babugouda Badarli Charitable Trust @ R.H.No.3, Main Road, Muchal Camp a Low Rise School Building Icon Future International School, R.H.No.3, Main Road, Muchal Camp, Taluk.Sindhanur, Dist:Raichur-584143.

Ref: 1). No:15/FSO /SFS/2025, Dated:07/08/2025.
2). Application Date:11/07/2025.

With reference to the subject above cited, the premises of Sri Babugouda Badarli Charitable Trust @ R.H.No.3, Main Road, Muchal Camp a Low Rise School Building Icon Future International School, R.H.No.3, Main Road, Muchal Camp, Taluk.Sindhanur, Dist:Raichur-584143. was inspected by FSO Sindhanur on Dated:07/08/2025 with respect to fire prevention, fire fighting and evacuation measures to be complied premises and Submitted building details as under.

A. Details of the Building/Premises:-

01.	Name and Address of the applicant.	:	The Principal Icon Future International School, R.H.No.3, Main Road, Muchal Camp, Taluk.Sindhanur, Dist:Raichur-584143.
02.	Name and Address of the premises.	:	Icon Future International School, R.H.No.3, Main Road, Muchal Camp, Taluk.Sindhanur, Dist:Raichur-584143.
03.	Name and Address of the Building owner.	:	Sri.AnjineyaS/o.Sri.Yalamanda at.PWD Camp Sindhanur, Taluk.Sindhanur Dist.Raichur-584128.
04.	Number of Buildings	:	01 Building.
05.	Number of floor	:	Ground+1 Upper floor.
06.	Floor-wise details of occupancy :-		
	Ground Floor	:	Room-11 No's,
	First Floor	:	Room-09 No's,
07.	Height of the building	:	10 Mtr.
08.	Area	:	5374.18 Sq.Mtrs.



Head Master
Icon Future International School
R.H. No.3, Main Road, Muchal Camp,
SINDHANUR-584143, DIST: RAICHUR

09	Built-up area of each floor :-	
	Ground Floor	: 493.98 Sq.Mtr.
	First Floor	: 419.56 Sq.Mtr.
10	Total built-up area	: 913.54 Sq.Mtr.
11	Surrounding properties:-	
	East (Front)	: Agriculture Land.
	West (Rear)	: School Building.
	North (Side)	: Main Road.
	South (Side)	: Agriculture Land.
12.	Set back area available around the Building:-	
	East (Front)	: 16.20 Mtrs.
	West (Rear)	: 6.20 Mtrs.
	North (Side)	: 160.50 Mtrs.
	South (Side)	: 4.20 Mtrs.

Recommended:
To provide as per Local
Zonal Regulations.

B. On inspection of this Institutional premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl.No [01]	Details [02]	Existing [03]	Recommendations [04]
01	Accessibility to Premises.	The premises is accessible from 07.00 Mtrs wide Internal Service Road On Northern Side.	Adequate.
02	No of entrances.	01 No 5.00 Mtrs.	-----
03	No. of staircases available	No of staircase : 01 No. Width of staircase : 1.40 Mtr. Width of treads : 29 CM Height of risers : 10 CM No of riser per flight : 14 No's. Height of handrails : 0.70 Mtrs Head room clearance : --	-----
04	Portable Fire Extinguisher	Not Provided.	Recommended To Provide 01) 01 No ABC Fire Extinguisher each of 6 kg capacity Should be Located as Available Within 15 Mtrs Radius. in each floor. 02) 01 No of CO2 Fire Extinguisher of 4.5 kg capacity Should be Provided near each Electrical Panel Board And Electrical Room. Switch board. 03.01 No of Mechanical Foam Extinguishers of 09 ltrs Capacity and 01 ABC type Extinguishers of 06 kg capacity should be provided near diesel Generator. 04. 01 DCP Extinguishers of 4 kg Capacity Should be provided [All the extinguishers suggested above should be with B.I.]



			markings and should be located at an easily accessible position without obstructing the normal passage and maintained periodically].
05	First aid Hose reel hose.	Not Provided.	Recommended To Provide 01 No of Hose reel hose Near the Staircase (one hose Reel hose System for every 1000 Sq Mtrs) The hose Reel of 30 mtr length with drum and 01 no's delivery hose pipes minimum 2 ½ inch size of adequate length to reach the farthest point of each floor has to be provide with a shut off branch having a nozzle of 2 mm size. The hose reel hose has been connected at each
06	Terrace tank over respective tower terrace.	Provided 2000 Liters Terrace Tank.	Recommended to Provide The System Should Be connected An Over Tank of 5000 Ltr water Capacity And Further Basement is Provided the Tank Capacity Should be Increased To 10000 Lts Capacity. (The Water Tank Should Be Kept Exclusively Fire Fighting Purpose). Note If the Existing Building is Not Capable Of sustaining the weight 5000/10000 Ltrs Tank Capacity Provision Shall be made to Provide Water Tank On the Side Of the Building With Support From Ground Level by providing RCC Column Structure are MS Column Structure. If The There No Option to Provide even the Above Mentioned Over Tank Provision Shall Made To provide Underground Water Tank Of capacity With Submersible Pump of 05 To 07 Hp Capacity.
07	At the terrace tank level with minimum pressure of 3.5 kg/cm2.	Not Provided.	Recommended To Provide To Provide 01 No pump with minimum pressure of 3.5 kg/sqcm.
08	Diesel Generators	Not Provided.	Recommended To Provide One adequate capacity of Diesel Generator should be provide and it should be connected to alternate power supply.
09	Escape routes	Not Marked.	Recommended To Provide Direction in which the students have to move in the event of an emergency should be displayed in the corridor in each floor during



10	Fire order (Fire Safety Plans)	Not Displayed	evacuation. The Notice board have been indicated the action should be taken by the employees in case of any emergency should be displayed with the telephone number of Sindhanur Fire Station i.e-08535-220777, 112 and the telephone number of nearest Ambulance services and Police Station.
11	No Smoking Board	Displayed	As per sec-4 of COPTA a board with words NO SMOKING AREA shall be written in English & Kannada both language shall be prominently displayed at inside the entry /exit of the each floor.
13	Fire Siren	Not Installed	A Fire Siren shall installed in the premises to inform the inmates in case of a fire emergency and evacuate the area.
14	Nominate Fire Fighting Training	Not Imparted	At-least 40% of School Staff should be got trained in basic fire fighting at R.A.Mundkur fire & Emergency Services Academy, Bannerughatta road, Bangalore within 3 months or at an early date.

Fire Precautionary Measures:-

- 15
- A. Explosive and Flammable Materials Should Not be Stored in the Store Room, UPS Room Electrical Panel Area, Class Rooms, Laboratory And Electrical Some Panel Premises.
 - B. Accumulation of combustible Waste in and around the premises should be avoided.
 - C. The Exit Ways Shall be always Kept Clear Without any obstruction.
 - D. Liquefied Petroleum Gas Should Not be Stored in the building.
 - E. The doors shall not kept Locked/ Latched during working hours and shall be free from obstruction.
 - F. During the class hours in the class room doors shall not be locked from inside to outside.
 - G. As per Honorable Supreme Court Order All Teachers and staffs Shall be trained to handle Safety Equipment, initiate Emergency Evacuation and Protect Their Students
 - H. in the event of Fire and other Emergency and the school shall observe the Fire Safety Day on April 14th Every Year by Conducting Fire Safety Drills with Co-ordinate with fire service Department.

Under the Circumstance stated above, there is No Objection to run Education activities in Sri Babugouda Badarli Charitable Trust @ R.H.No.3, Main Road, Muchala Camp a Low Rise School Building Icon Future International School, R.H.No.3, Main Road, Muchal Camp, Taluk.Sindhanur, Dist:Raichur-584143. School Building subject to the Condition of providing Additional Fire Fighting Equipments and Fire precautionary measures shown in Part-B. Therefore management should compulsory Karnataka Fire And Emergency Services Department conditions to provide Additional Equipments And Then Intimate to the office Within 90 days Positively Without Fail. **This Fire Safety Recommendation Certificate Valid for Only One Year From The date of issue and renewable without fail**.

All Requirements Recommended above are as per National Building Code-2016 Part-4 Clause 3.1.3 of Fire And Life Safety Will have to be complied With Mandatorily.

U DISE Number: 29064100120

(Signature)
 ದತ್ತಾತ್ರೇಯ ಅಧಿಕಾರಿ
 ಸಾರ್ವಜನಿಕ ಅಗ್ನಿಶಾಮಕ ಮತ್ತು ಕುಶಲ ಸೇವಾ
 ಇಲಾಖೆ, ಸಿಂಧಾನೂರು-584102

Copy To,
 1.The D.G.P. KSF&ES
 Bangalore.
 2.Fire Station Officer
 Fire Station Sindhanur.

Karnataka State Fire And Emergency Services Department



Office of the District fire officer
Karnataka state fire and Emergency Services
Raichur Fire station, Raichur 584102,



C.NO:14/FSR/DFO/RCR/2024

Date:13/2/2024

"Fire Safety Recommendation"

ANNEXURE-II

Group-B Educational Building of Ground floor Only
"B1 And B2- Schools Up to Senior Secondary Level and other Institutions"
NBC-2016, Part-4, Table 7 (11) 3. 1. 3 Group-B Educational Buildings

To,

The Headmaster
Icon Future International School,
Sy No 122/*/10/RHC .03 Main Road Muchal Camp,
Taluk// Sindahnur, District //Raichur-584143,

Sir/Madam,

Sub:- Issue of "Fire Safety Recommendation "Icon Future International School,
Sy No 122/*/10/RHC .03 Main Road Muchal Camp, Taluk// Sindahnur,
District //Raichur-584143

Ref : 1. Applicant Request Letter on Dated 10/02/2024
2. Inspection Report/2024, Dated:13/02/2024

With reference to the subject above cited, the premises of Icon Future International School, Sy No 122/*/10/RHC .03 Main Road Muchal Camp, Taluk// Sindahnur, District //Raichur-584143 Run Under Babu Gowda Charitable Trust Muchal Camp Taluk || Sindahnur, District || Raichur was inspected by Me on Date: 12/02/2024 with respect to fire prevention, fire fighting and evacuation measures to be complied premises and Submitted building details as under.

A.3 Details of the Building/Premises:-

01.	Name and Address of the applicant.	:	The President, Babu Gowda Charitable Trust Muchal Camp, Taluk Sindahnur, District Raichur
02.	Name and Address of the premises.	:	Icon Future International School, Sy No 122/*/10/RHC .03 Main Road Muchal Camp, Taluk// Sindahnur, District //Raichur-584143.
03.	Name and Address of the Building owner.	:	Sri Anjaneya Yakamanda PWD Camp Sindahnur , Taluk Sindahnur, District Raichur
04.	Number of Buildings	:	01 No Building.
05.	Number of floors	:	Ground floor
06.	Floor-wise details of occupancy :-		
	Ground Floor:	:	1) Class Room-08 No 2) Office Room-01 No
07.	Height of the building	:	04.30 Mtr.

R. S. D.
Head Master
Icon Future International School

08	Site area	:	5574.18 Sq.Mtr
09	Built-up area of each floor :-		
	Ground Floor:	:	632.76 Sq.Mtr.
10	Total built-up area	:	632.76 Sq.Mtr.
11	Surrounding properties:-		
	East (Front)	:	Play Gound & Agricultre Land
	West	:	Others Agriculture Land
	North	:	Others Agriculture Land
	South	:	Others Agriculture Land
12.	Set back area available around the Building:-		
	East (Front)	:	03.00 Mtrs & Open Place
	West	:	01.00 Mtrs
	North	:	03.00 Mtr and Open Place
	South	:	02.00 Mtr
			Recommended: To provide as per Local Zonal Regulations.

B. On inspection of this Institutional premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl. No. [01]	Details [02]	Existing [03]	Recommendations [04]																					
01	Accessibility to Premises.	The premises is accessible from 06.00 Mtrs Wide road Towards Southern side.	Adequate.																					
02	No of entrances..	Direct To Entry	----																					
03	No. of staircases available	<table border="1"> <tr> <td>No of staircase</td> <td>:</td> <td>--</td> </tr> <tr> <td>Width of staircase</td> <td>:</td> <td>--</td> </tr> <tr> <td>Width of treads</td> <td>:</td> <td>--</td> </tr> <tr> <td>Height of risers</td> <td>:</td> <td>--</td> </tr> <tr> <td>No of riser per flight</td> <td>:</td> <td>---</td> </tr> <tr> <td>Height of handrails</td> <td>:</td> <td>---</td> </tr> <tr> <td>Head room clearance</td> <td>:</td> <td>--</td> </tr> </table>	No of staircase	:	--	Width of staircase	:	--	Width of treads	:	--	Height of risers	:	--	No of riser per flight	:	---	Height of handrails	:	---	Head room clearance	:	--	-----
No of staircase	:	--																						
Width of staircase	:	--																						
Width of treads	:	--																						
Height of risers	:	--																						
No of riser per flight	:	---																						
Height of handrails	:	---																						
Head room clearance	:	--																						
04	Portable Extinguisher	Not Provided	01).01 No ABC Fire Extinguisher each of 6 kg capacity. Should be Located As Available Within 15 Mtrs Radius. in each floor. 02) 01 No of CO2 Fire Extinguisher of 4.5 kg capacity Should be Provided near each Electrical																					

			Panel Board And Electrical Room, Switch board. 03). 01 Mechanical Foam Extinguishers of 09 ltrs Capacity and 01 ABC type Extinguishers of 6 kg capacity should be provided near diesel Generator. 04). 01 DCP Extinguishers of 4 kgs. capacity Should be provided in the Kitchen if Provided for th purpose of mid day meal. [All the extinguishers suggested above should be with B.I.S. markings and should be located at an easily accessible position without obstructing the normal passage and maintained periodically].
	Escape routes	Not Marked.	Recommended To Provide Direction in which the students have to move in the event of an emergency should be displayed in the corridor in each floor during evacuation.
06	Fire order (Fire Safety Plans)	Not Displayed	The Notice board, have been indicted the action should be taken by the employees in case of any emergency should be displayed with the telephone number of Sindahnur Fire Station i.e-08535-220777, 101& and the telephone number of nearest Ambulance services and Police Station.
07	No Smoking Board	Not Displayed	As per sec-4 of COPTA a board with words NO SMOKING AREA shall be written in English & Kannada both language shall be prominently displayed at inside the entry /exit of the each floor.
08	Training in Fire fighting	Not Imparted	At-least 40% of School Staff should be got trained in basic fire fighting at R.A.Mundkur fire & Emergency Services Academy, Bannerughatta road, Bangalore within 3 months or at an early date.
09	Fire Siren	Not Installed	A Fire Siren shall installed in the premises to inform the inmates in case of a fire emergency and evacuate the area.
10	Nominate one fire	-----	A Fire Nodal Officer shall be


[Handwritten Signature]

Head Master

	Nodal officer	nominated either from teaching or non teaching staff.
11	<p><u>Fire Precautionary Measures:-</u></p> <p>A. Explosive and Flammable Materials Should Not be Stored in the Store Room, UPS Room Electrical Panel Area, Class Rooms, Laboratory And Electrical Rooms on Premises.</p> <p>B. Accumulation of combustible Waste in and around the premises should be avoided.</p> <p>C. The Exit Ways shall be always Kept Clear without any obstruction.</p> <p>D. Liquefied Petroleum Gas Should Not be Stored in the building.</p> <p>E. The doors shall not kept Locked/ Latched during working hours and shall be free from obstruction.</p> <p>F. During the class hours in the class room doors shall not be locked from inside or outside.</p> <p>G. As per Honorable Supreme Court Order All Teachers and staffs Shall be trained to handle Safety Equipment, initiate Emergency Evacuation and Protect Their Students in the event of Fire and other Emergency and the school shall observe the Fire Safety Day on April 14th of Every Year by Conducting Fire Safety Drills with Co-ordinate with fire service Department.</p>	

Under the Circumstance stated above, there is No Objection to run Education activities in your Icon Future International School, Sy No 122/*/10/RHC .03 Main Road, Muchal Camp, Taluk// Siddanur District //Raichur-584143 125 School Building subject to the Condition of providing Additional Fire Fighting Equipments and Fire precautionary measures shown in Para-B. Therefore manager should compulsory Karnataka Fire And Emergency Services Department conditions to provide Additional Equipments And Then Intimate to the office Within 90 days Positively Without Fail. **"The Fire Safety Recommendation Certificate Valid for Only One Year From The date of issue and renewable without fail"**.

All Requirements Recommended above are as per National Building Code-2016 Part-4 Clause 3.1.3 of Fire And Life Safety Will have to be complied With Mandate.

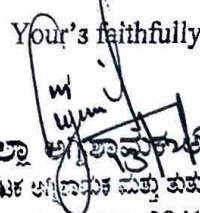Your's faithfully

 ದಲಾ ಅಧಿಕಾರಿಗಳ ಕಛೇರಿ
 ಕರ್ನಾಟಕ ಅಗ್ನಿಶಾಮಕ ಮತ್ತು ತುರ್ತು ಸೇವೆಗಳು
 ರಾಯಚೂರು -584102

Karnataka State Fire And Emergency Services Department



Office of the District fire officer
Karnataka state fire and Emergency Services
Raichur Fire station, Raichur 584102,



C.NO:93/FSR/DFO/RCR/2025

Date:15/11/2025

"Fire Safety Recommendation"

ANNEXURE-I

Group-B Educational Building

"B1 And B2- Schools Up to Senior Secondary Level and other institutions"
NBC-2016, Part-4, Table 7 (1) 3. 1.3 Group-B Educational Buildings

To,

The Authorized Signatory,
The Principal
Icon Future international school
R. H No-3 Main Road, Muchal camp Sindhanur
Taluk Sindhanur, Dist Raichur-584128.

Sub-Issue of "Fire Safety Recommendation" to **Sri Babugouda Badarli Charitable Trust @ Sindhanur**, a Constructed Low Rise School Building **Icon Future international School**, At R.H No-3 Main Road Muchal Camp Sindhanur, Taluk Sindhanur, Dist Raichur-584128.

Ref : 1). No:26/FSO/SFS/2025, Dated:12/11/2025
2). Applicant Request Date:11/11/2025

With reference to the subject above cited, the premises of **Sri Babugouda Badarli Charitable Trust @ Sindhanur**, a Constructed Low Rise School Building **Icon Future International School**, At R.H No-3 Main Road Muchal Camp Sindhanur, Taluk Sindhanur, Dist Raichur-584128, was inspected by FSO Sindhanur on Dated:12/11/2025 with respect to fire prevention, fire fighting and evacuation measures to be complied premises and Submitted building details as under.

A. Details of the Building/Premises:-

01.	Name and Address of the applicant.	The Principal Sri Babugouda Badarli Charitable Trust @ Sindhanur At R.HNO-3 Main Road Muchal Camp Sindhanur, Taluk Sindhanur, Dist Raichur-584128.
02.	Name and Address of the premises.	Icon Future international school English Medium School, At R. H No-3 Main Road Muchal camp Sindhanur, Taluk Sindhanur, Dist Raichur-584128.
03.	Name and Address of the Building owner.	The President Sri Anjaneya Yalkamanda Pwd camp Sindhanur, Taluk Sindhanur, Dist Raichur-584128.
04.	Number of Buildings	01 Building.
05.	Number of floor	Ground+1 Upper floor.
06.	Floor-wise details of occupancy :-	
	Ground Floor	1).Class Room-14No's. 2).Office Room-01 No 3).Computr Lab-01 No, 4).President Room-01 No. 5).Toilets.



Head Master

Icon Future International School

	First Floor	:	1).Class Room-08 No's.
07	Height of the building	:	08.08 Mtrs.
08	Site area	:	1597.00 Sq.Mtrs.
09	Built-up area of each floor :-		
	Ground Floor	:	335.22 Sq.Mtr.
	First Floor	:	335.22 Sq.Mtr.
10	Total built-up area	:	670.44 Sq.Mtr.
11	Surrounding properties:-		
	East (Rear)	:	Under construction Hostel building
	West (Front)	:	Residential House
	North (Side)	:	Road.
	South (Side)	:	Agricultural land
12	Set back area available around the Building:-		
	East (Rear)	:	10.90 Mtrs
	West (Front)	:	08.80
	North (Side)	:	42.40 Mtrs
	South (Side)	:	4.20 Mtrs
			Recommended: To provide as per Local Zonal Regulations.

B. On inspection of this Institutional premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl.No [01]	Details [02]	Existing [03]	Recommendations [04]																					
01	Accessibility to Premises.	The Premises is accessible from 05.00 Mtrs wide Service Road on Northern Side.	Adequate.																					
02	No of entrances.	01 No. 3.70 Mtrs.	-----																					
03	No. of staircases available	<table border="1"> <tr> <td>No of staircase</td> <td>:</td> <td>02 No's.</td> </tr> <tr> <td>Width of staircase</td> <td>:</td> <td>0.85 Mtr. 1.10 Mtr.</td> </tr> <tr> <td>Width of treads</td> <td>:</td> <td>13 CM 12 CM</td> </tr> <tr> <td>Height of risers</td> <td>:</td> <td>14 CM 14 CM</td> </tr> <tr> <td>No of riser per flight</td> <td>:</td> <td>12 No's. 17 No's.</td> </tr> <tr> <td>Height of handrails</td> <td>:</td> <td>0.90 Mtrs. 0.95 Mtrs.</td> </tr> <tr> <td>Head room clearance.</td> <td>:</td> <td>-- --</td> </tr> </table>	No of staircase	:	02 No's.	Width of staircase	:	0.85 Mtr. 1.10 Mtr.	Width of treads	:	13 CM 12 CM	Height of risers	:	14 CM 14 CM	No of riser per flight	:	12 No's. 17 No's.	Height of handrails	:	0.90 Mtrs. 0.95 Mtrs.	Head room clearance.	:	-- --	---
No of staircase	:	02 No's.																						
Width of staircase	:	0.85 Mtr. 1.10 Mtr.																						
Width of treads	:	13 CM 12 CM																						
Height of risers	:	14 CM 14 CM																						
No of riser per flight	:	12 No's. 17 No's.																						
Height of handrails	:	0.90 Mtrs. 0.95 Mtrs.																						
Head room clearance.	:	-- --																						
04	Portable Fire Extinguisher	Not Provided	<u>Recommended To Provide</u> 01) 01 No ABC Fire Extinguisher each of 6 kg capacity Should be Located as Available Within 15 Mtrs Radius. in each floor. 02) 01 No of CO2 Fire Extinguisher of 4.5 kg capacity Should be Provided near each Electrical Panel Board And Electrical Room. Switch board. 03) 01 No of Mechanical Foam Extinguishers of 09 ltrs Capacity and 01 ABC type Extinguishers of 06 kg capacity should be provided near diesel Generator. 04. 01 DCP Extinguishers of 4 kgs																					



			Capacity Should be provided. [All the extinguishers suggested above should be with B.I. 3 markings and should be located at an easily accessible position without obstructing the normal passage and maintained periodically].
05	First aid Hose reel hose.	Not Provided.	Recommended To Provide 01 No. of Hose reel hose: Near the Staircase (one hose Reel hose System for every 1000 Sq Mtrs) The hose Reel of 30 Mtr length with drum and 01 no's delivery hose pipes minimum 2 1/2 inch size of adequate length to reach the farthest point of each floor has to be provide with a shut off branch having a nozzle of 2 mm size. The hose reel hose has been connected at each
06	Terrace tank over respective tower terrace.	Provided 6000 Liters Capacity Syntax Tank For Domestic Purpose.	Recommended to Provide. The System Should Be connected An Over Tank of 5000 Ltr water Capacity And Further Basement is Provided the Tank Capacity Should be Increased To 10000 Ltrs Capacity. (The Water Tank Should Be Kept Exclusively Fire Fighting Purpose). Note If the Existing Building is Not Capable Of sustaining the weight 5000/10000 Ltrs Tank Capacity Provision Shall be made to Provide Water Tank On the Side Of the Building With Support From Ground Level by providing RCC Column Structure are MS Column Structure. If The There No Option to Provide over the Above Mentioned Over Tank Provision. Shall Made To provide Underground Water Tank Of capacity With Submersible Pump of 05 To 07 Hp Capacity.
07	At the terrace tank level with minimum pressure of 3.5 kg/cm ² .	Not Provided.	Recommended To Provide To Provide 01 No pump with minimum pressure of 3.5 kg/sqcm.
08	Diesel Generators	Not Provided.	Recommended To Provide One adequate capacity of Diesel Generator should be provide and it should be connected to alternate power supply.
09	Escape routes		Recommended To Provide Direction in which the students have to move in the event of an emergency should be displayed in



			evacuation.
10	Fire order (Fire Safety Plans)	Not Displayed	Recommended To Provide The Notice board have been indicted the action should be taken by the employees in case of any emergency should be displayed with the telephone number of Sindhanur Fire Station-08535-220777 and the telephone number of nearest Ambulance services and Police Station.
11	No Smoking Board	Not Displayed	Recommended To Provide As per sec-4 of COPTA a board with words NO SMOKING AREA shall be written in English & Kannada both language shall be prominently displayed at inside the entry /exit of the each floor.
13	Fire Siren	Not Installed	A Fire Siren shall installed in the premises to inform the inmates in case of a fire emergency and evacuate the area.
14	Nominate Fire Fighting Training	Not Imparted	At-least 40% of School Staff should be got trained in basic fire fighting at R.A.Mundkur fire & Emergency Services Academy, Bannerughatta road, Bangalore within 3 months or at an early date.
15	Fire Precautionary Measures:- A. Explosive and Flammable Materials Should Not be Stored in the Store Room, UPS Room Electrical Panel Area, Class Rooms, Laboratory And Electrical Some Panel Premises. B. Accumulation of combustible Waste in and around the premises should be avoided. C. The Exit Ways Shall be always Kept Clear Without any obstruction. D. Liquefied Petroleum Gas Should Not be Stored in the building. E. The doors shall not kept Locked/ Latched during working hours and shall be free from obstruction. F. During the class hours in the class room doors shall not be locked from inside to outside. G. As per Honorable Supreme Court Order All Teachers and staffs Shall be trained to handle Safety Equipment, initiate Emergency Evacuation and Protect Their Students H. in the event of Fire and other Emergency and the school shall observe the Fire Safety Day on April 14 th of Every Year by Conducting Fire Safety Drills with Co-ordinate with fire service Department.		


Under the Circumstance stated above, there is No Objection to run Education activities in to Sri Babugouda Badarli Charitable Trust @ Sindhanur, a Constructed Low Rise School Building Icon Future international school, At R.H no-3 Main Road Muchal Camp Sindhanur, Taluk Sindhanur, Dist Raichur-584 1 28. School Building subject to the Condition of providing Additional Fire Fighting Equipments and Fire precautionary measures shown in Part-B Therefore management should compulsory Karnataka Fire And Emergency Services Department conditions to provide Additional Equipments And Then Intimate to the office Within 90 days Positively Without Fail. **This Fire Safety Recommendation Certificate Valid for Only One Year From The date of issue and renewable without ail.**

All Requirements Recommended above are as per National Building Code-2016 Part-4 Clause 3.13 of Fire And Life Safety Will have to be complied With Mandatorily.

U DISE No:- 29064100120

Copy To,
1. The D.G.P. KSF&ES
Banglore.
2. Fire Station Officer
Fire Station Sindhanur.

Your's faithfully


ಮುಖ್ಯ ಅಧಿಕಾರಿ
ಕರ್ನಾಟಕ ಅಗ್ನಿ ಮತ್ತು ಕುಟುಂಬ ಸೇವಾ
ದಾಖಲೆ ಸಂಖ್ಯೆ-584102